

# PROGRAMMABLE AC POWER SOURCE MODEL 61511/61512/61611/61612

The global market for AC power testing has created demand for a more sophisticated, high performance AC power source that is capable of simulating a wide range of AC line conditions. The Chroma 61500/61600 series programmable AC sources are the solution to meet this demand. These sources provide the ability to simulate various AC line input conditions as well as the measurement of critical characteristics for products under test. These features make the 61500/61600 series ideal for commercial, power electronics, avionics, military, and regulation test applications from bench-top R/D design verification to quality assurance and mass production.

Using state of the art PWM technology, the 61511/61512/61611/6162 models can deliver a maximum output voltage of up to 300Vac and an output frequency from 15Hz to 1500Hz. The AC+DC modes extend the abilities by not only providing pure AC voltage, but also a DC component for DC offset testing in the laboratory.

The 61511/61512/61611/61612 AC sources are capable of delivering up to 4 times the peak current compared to the maximum rated current which makes it ideal for inrush current tests. All models possess the ability to generate a pure sine waveform output with typical distortion of less than 0.3% at 50/60Hz.

The Chroma 61500/61600 series are able to provide precision measurements such as RMS voltage, RMS current, true power, power factor, current crest factor and more. By applying advanced DSP technology, the 61511/61512 models can easily simulate power line disturbance (PLD) through LIST, PULSE and STEP modes.

The Chroma 61500/61600 series allow users to compose different harmonic components to synthesize various harmonic distorted waveforms. By applying this advanced feature, users can program a sweeping frequency component incorporated with the fundamental voltage for finding resonance points of the UUT, thus providing the user with in depth analysis results.

To simulate the natural waveform, the 61500/61600 series include an external analog input used to amplify the analog signal generated from an arbitrary signal generator. Users can implement this feature to duplicate any unique waveform observed in the field.

The user friendly interface allows user quick access to the 61511/61512/61611/61612 AC source's functions through a large LCD display on the front panel, with a clearly indicated keypad. GPIB (IEEE488.2), RS-232, USB, and Ethernet interfaces are available for remote control of the AC source.



# MODEL 61511/61512 61611/61612

#### **KEY FEATURES**

- Power rating:
  - 61511/61611: 12KVA
  - 61512/61612: 18KVA
- Voltage range: 0~150V/0~300V/auto
- Frequency: DC, 15Hz~1500Hz
- Single phase or three phase output selectable
- Programmable slew rate setting for changing voltage and frequency
- Programmable voltage and current limit
- High output current crest factor, ideal for inrush current testing
- Turn on, turn off phase angle control
- TTL signal which indicates output transient
- LIST, PULSE, STEP mode functions for testing power line disturbance (PLD) simulation
- Voltage dips, short interruption and voltage variation simulation
- Harmonics, inter harmonics waveform synthesizer
- Comprehensive measurement capability, including current harmonics
- Analog programmable interfaces
- Remote interface: GPIB, RS 232, USB, and Ethernet
- Capable of delivering power output up to 90KVA by implementing master slave parallel operation



# Chroma


## ADVANCED PWM TECHNOLOGY

The Chroma 61500/61600 series AC power sources are able to provide the highest power density through an advanced high speed PWM mode design. The modularized power stage design offers outstanding performance and high reliability. This design also allows service personnel to identify trouble spots more efficiently and minimize downtime. With no transformer at the output stage, it not only reduces output impedance, but also allows the 61500/61600 series to be able to program a DC component for simulating AC voltage with a DC offset condition. This function allows users to simulate test conditions for unbalanced input currents for rectified loads.

## SINGLE-PHASE AND THREE-PHASE OUTPUT

Model 61511/61512/61611/61612 AC sources are capable of delivering either single or three-phase output depending on the application. Users can select these output modes easily through front panel or via remote control. Model 61511/61512/61611/61612 AC

sources are able to provide full power output without derating even with the output configured as single phase.



Phase Waveform








## SLEW RATE SETTING FOR VOLTAGE AND FREQUENCY

Model 61511/61512/61611/61612 AC sources let users set the slew rate for voltage and frequency. It will follow the slew rate to reach the final setting when the output voltage or frequency is changed. This function can help users verify the operation range of input power. For example, a user can implement this feature to sweep the voltage gradually from 90V to 264V, instead of only checking several points like 90V, 115V, 230V and 264V. Slew rate can also be used to reduce the inrush current during motor startup or power on of multiple UUT.

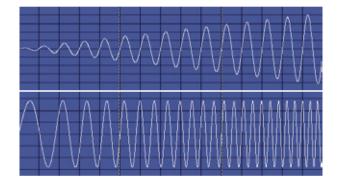


#### COMPREHENSIVE MEASUREMENTS

The Chroma model 61500/61600 AC power sources have a built in 16-bit measurement circuit and firmware utilities for measuring true RMS voltage, current, true power, VA (apparent power), VAR (reactive power), power factor, current crest factor, peak repetitive current, and inrush current. Using the advanced DSP technology, 61500 series can measure THD and up to 40 orders of current harmonics. This makes the 61500 series not only a sophisticated power source, but also a powerful electrical analyzer.

#### POWER LINE DISTURBANCE SIMULATION (61500 SERIES)

In addition to steady output voltage and frequency programming, Chroma AC power source 61500 series provides powerful functions to simulate a variety of power line disturbance conditions. The STEP and PULSE modes offer an easy and convenient method to execute either single step or continuous output changes. These changes may be triggered by either internal or external events. With this capability, it is easy to simulate power line disturbances like cycle dropouts, transient spikes, brown outs, and more.

The LIST Mode extends these functions for more complex waveform generation needs. With up to 100 sequences of different start-end conditions, the source can perform almost any waveform possible for AC and DC components. In this way, the Chroma AC power source 61500 series is capable of simulating all sorts of voltage dips, interruptions, and variation waveforms for IEC 61000-4-11, IEC 61000-4-14, and IEC 61000-4-28 compliance tests. It also allows users to synchronize external events and measurement devices with output changes.




#### DISTORTION WAVEFORM, HARMONICS, INTERHARMONICS SYNTHESIS (61500 SERIES)


Traditional types of AC sources only provide an output voltage with a sine waveform, and this type of AC source is unable to meet and keep up with the latest test requirements for simulating input voltage abnormal conditions with distortion waveforms. The WAVEFORM function allow user to set square, clippedsine wave and 30 stored distortion waveforms.

The 61500 series allows users to composite up to 40 orders of harmonic components based on a 50Hz or 60Hz fundamental. The output will be a periodic harmonics distorted waveform. It also provides a sweeping interhamonics function. This means that the fundamental frequency will incorporate with a frequency sweeping component between harmonic frequencies. It can help to find the resonance or the weakest points of a UUT. The Chroma AC source 61500 series uses advanced DSP technology to synthesize the harmonic and interharmonics waveforms. Therefore it is capable of generating a periodic harmonic and nonperiodic harmonic distorted waveform to perform IEC 61000-4-13 compliance tests.

#### PROGRAMMABLE OUTPUT IMPEDANCE (61500 SERIES)

The Chroma AC source 61500 series allows users to program output impedance. A current feedback control circuit causes the output voltage to change with the load. This feature is suitable for IEC 61000-3-3 Flicker tests, or other test conditions with a particular output impedance requirement. It provides users a convenient and cost effective way to implement the reference impedance.

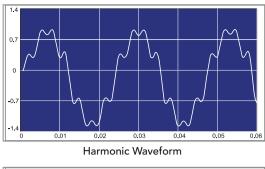

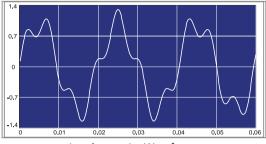

Interharmonics Waveform

#### AC SOURCE - MASTER - SLAVE - PARALLEL OPERATION

The 61511/61512/61611/61612 AC source models provide Master-Slave parallel operation, which allows users to extend the AC source power output capability by connecting multiple AC sources in parallel. The maximum allowable number of AC sources that can be implemented in parallel operation is 5 units. Users can achieve a maximum power output up to 90KVA by combining 5 units of assorted AC source of 18KVA in Master-Slave parallel operation. The user could also use the A615103 Power Stage as an alternative cost effective solution for parallel operation, by implementing it as slave unit. Please refer to the following figures to setup for parallel operation of AC source models 61511/61512/61611/61612.



Master Mode

Slave Mode



Combine two units of Model 61512 for obtaining 36KVA power output or combine AC source models 61512 + 61511 for obtaining 30KVA power output

Combine AC source Model 61512 with two units of A615103 (18KVA) for obtaining 54KVA power output




A615104: Input/Output terminal fixture for connecting 2 parallel AC source units.

To reduce the hassle of arranging the input and output wiring of multiple AC sources connected for parallel operation, users can implement the Chroma input/output terminal fixture (A615104/A615105) designed specifically to make the wiring simple.


#### THE 61500/61600 SERIES SOFTPANEL\*

The Chroma Softpanel is a graphical user interface which provides extraordinary capability and convenience to users for remote control and operation of the unit. The 61500/61600 series Softpanel is designed specifically for offering users control of the AC source by applying a user friendly interface in a graphical, instrument like setting. The self-explanatory graphical interface makes configuration of the extensive functions of the AC source easy with just few clicks of the mouse. Users are able to perform online and offline waveform editing with the implementation of the Softpanel. The Softpanel is also designed with data recording functions so that multiple measurements can be recorded simultaneously. One of the most powerful features of the Softpanel is the availability of a test environment configured specifically for conducting IEC regulation tests like IEC 61000-4-11, IEC 61000-4-13, IEC 61000-4-14, and IEC 61000-4-28.

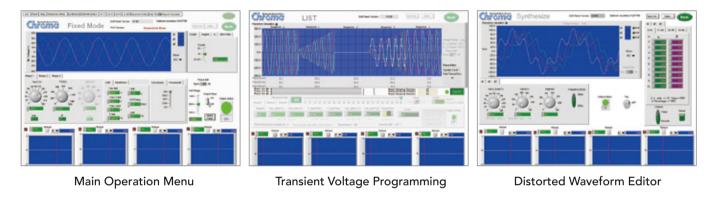




Voltage DIP, Short Interruption, Variation Regulation Test

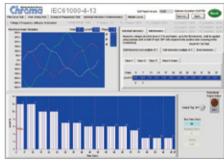


Voltage Harmonic & Interharmonic Test



Voltage Fluctuation Test

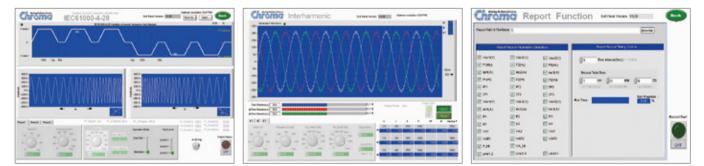

**Frequency Variation Test** 



#### **Recording Function**

\* Softpanel support functions are actually depending on the AC Source model being implemented. For instance, Softpanel will not provide support for LIST mode function if 61600 series AC Source is implemented.

SPECIFICATIONS									
Model	61511	61611	61512	61612		61611+A61510	3 61512+A615103	61612+A61	
Dutput Phase				1 or	3 selectable				
Output Rating-AC Power	12kV	/^	194	/^	30k	۸/۸	36k	.//	
Each Phase	4kV/		18kVA 6 kVA		10k		12k		
/oltage	46.07	Η.	0 6 6	A	TOR	(VA	IZK	VA	
lange				0~1	50V/0~300V				
Accuracy	0.1%+0.2%F.S.								
Resolution	0.1 V								
Distortion *1	0.3% @ 50/60Hz , 1% @ 15~1kHz,1.5% @ >1kHz								
ine Regulation	0.1%								
oad Regulation *2	0.2%								
emp. Coefficient			0.2% per degree from 25°C						
/lax Current (1-phase mode)	<u>I</u>			0.0270 per	degree nom 25 0				
MS	96A / 4	48A	144A / 72A		240A / 120A		288A / 144A		
Peak (CF=4)	384A / 1		576A / 288A		960A / 480A		1152A / 576A		
Aax Current (each phase in 3-ph			0/0/(/	20071	700/17	10071	1102/17	07071	
Max current (each phase in 5-pr	32A / 1	164	48A /	244	80A	/ 404	96A /	484	
Peak (CF=4)	128A / 64A		192A / 96A		320A / 160A		384A /		
requency	12047	04/1	17287	704	32047	100A	30477	1728	
ange				DC	15~1 5kHz				
ange Accuracy	DC, 15~1.5kHz 0.01%								
esolution	0.01%								
hase					0.01112				
				~	) 250 0°				
lange				(	) ~ 359.9°				
lesolution			0.3°						
Accuracy				<0.8	3° @ 50/60Hz				
OC Output (1-phase mode)	(1)4	,	011	• /	45		4.01		
ower	6kW		9kW			kW	18k		
oltage	212V / 4		212V /			/ 424V	212V /		
Current	48A / 2	24A	72A /	36A	120A	/ 60A	144A /	72A	
OC Output (3-phase mode)									
Power	2kW		3kW		5kW			6kW	
/oltage	212V / 4		212V / 424V			/ 424V	212V /		
Current	16A /	8A	24A / 12A		40A /	/ 20A	48A /	24A	
nput AC Power (each phase)							-		
AC type				3-phase, De	elta or Y connecting	1			
			30		0%V <sub>LN</sub> (Delta: L-L ; `				
requency Range			30		47-63 Hz	Y: L-N)			
requency Range	Delta: 80A ;	Y: 70A*6	30 Delta: 120A		47-63 Hz		Delta: 240A ;	; Y: 180A *6	
requency Range Max. Current Measurement	Delta: 80A ;	Y: 70A*6			47-63 Hz	Y: L-N)	Delta: 240A ;	; Y: 180A *6	
requency Range Max. Current Measurement	Delta: 80A ;	Y: 70A*6			47-63 Hz	Y: L-N)	Delta: 240A ;	; Y: 180A *6	
requency Range Max. Current Measurement /oltage	Delta: 80A ;	Y: 70A*6		; Y: 90A *6	47-63 Hz	Y: L-N)	Delta: 240A ;	; Y: 180A *6	
requency Range Aax. Current Aeasurement /oltage Range	Delta: 80A ;	Y: 70A*6		; Y: 90A *6 1!	47-63 Hz Delta: 200A	Y: L-N)	Delta: 240A ;	; Y: 180A *6	
requency Range Max. Current Measurement Yoltage Range Accuracy	Delta: 80A ;	Y: 70A*6		; Y: 90A *6 1!	47-63 Hz Delta: 200A 50V / 300V	Y: L-N)	Delta: 240A ;	; Y: 180A *6	
requency Range Max. Current Measurement Yoltage Range Accuracy Resolution	Delta: 80A ;	Y: 70A*6		; Y: 90A *6 1!	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S.	Y: L-N)	Delta: 240A ;	; Y: 180A *6	
requency Range Max. Current Measurement foltage Range Accuracy Resolution Current	Delta: 80A ;			; Y: 90A *6 1! 0.1	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V	Y: L-N)	Delta: 240A ;		
requency Range Max. Current Measurement Voltage Range Range Resolution Current Range			Delta: 120A	; Y: 90A *6 1! 0.1 ? A peak	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V	Y: L-N) ; Y: 160A *6			
requency Range Max. Current Measurement Koltage Range Range Resolution Current Range Raccuracy (RMS)			Delta: 120A	; Y: 90A *6 1! 0.1 ? A peak 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2	Y: L-N) ; Y: 160A *6			
requency Range Max. Current Measurement foltage Range Accuracy Resolution Current Range Accuracy (RMS) Accuracy (peak)			Delta: 120A	; Y: 90A *6 1! 0.1 ? A peak 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S.	Y: L-N) ; Y: 160A *6			
requency Range Max. Current Measurement foltage Range Accuracy Resolution Current Range Accuracy (RMS) Accuracy (peak) Resolution			Delta: 120A	; Y: 90A *6 1! 0.1 ? A peak 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S.	Y: L-N) ; Y: 160A *6			
requency Range Max. Current Measurement foltage lange kccuracy tesolution Current lange kccuracy (RMS) kccuracy (peak) tesolution			Delta: 120A	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S.	Y: L-N) ; Y: 160A *6			
requency Range Max. Current Measurement foltage lange ccuracy tesolution current lange cccuracy (RMS) cccuracy (peak) tesolution fower cccuracy			Delta: 120A	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A	Y: L-N) ; Y: 160A *6			
requency Range Aax. Current Aeasurement /oltage lange Accuracy Resolution Current Range Accuracy (RMS) Accuracy (peak) Resolution Power Accuracy Resolution			Delta: 120A	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S	Y: L-N) ; Y: 160A *6			
requency Range Max. Current Measurement foltage lange Accuracy Resolution Current lange Accuracy (RMS) Accuracy (peak) Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power	128/32/8 /		Delta: 120A	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W	Y: L-N) ; Y: 160A *6	384/96/24		
requency Range Aax. Current Aeasurement /oltage ange Accuracy Resolution Accuracy (RMS) Accuracy (peak) Resolution Power Accuracy Resolution Dthers Power Line Distortion			Delta: 120A	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/	Y: L-N) ; Y: 160A *6	384/96/24		
irequency Range Aax. Current Aeasurement Voltage Vange Vange Vacuracy Vacuracy Vacuracy (RMS) Vacuracy (Peak) Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Power Vacuracy Power Vacuracy Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Po	128/32/8 / LIST/PULSE/ STEP functions	A peak	Delta: 120A 192/48/12 LIST/PULSE/ STEP functions	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions	Y: L-N) ; Y: 160A *6 0 A peak	LIST/PULSE/ STEP functions	A peak	
irequency Range Aax. Current Aeasurement Voltage Vange Vange Vacuracy Vacuracy Vacuracy (RMS) Vacuracy (Peak) Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Power Vacuracy Power Vacuracy Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Po	128/32/8 /	A peak	Delta: 120A	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/	Y: L-N) ; Y: 160A *6	384/96/24		
irequency Range Aax. Current Aeasurement Voltage Vange Vange Vacuracy Vacuracy Vacuracy (RMS) Vacuracy (Peak) Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Resolution Power Vacuracy Power Vacuracy Power Vacuracy Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Power Po	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders	A peak	Delta: 120A 192/48/12 LIST/PULSE/ STEP functions 40 orders	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders	Y: L-N) ; Y: 160A *6 0 A peak	LIST/PULSE/ STEP functions 40 orders	A peak	
requency Range Aax. Current Aeasurement foltage lange Accuracy tesolution Current lange Accuracy (RMS) Accuracy (peak) tesolution lower Accuracy tesolution Cover Accuracy tesolution Cover Accuracy tesolution Cover Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy	LIST/PULSE/ STEP functions 40 orders @ 50/60Hz	A peak	Delta: 120A 192/48/12 LIST/PULSE/ STEP functions 40 orders © 50/60Hz	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz	Y: L-N) ; Y: 160A *6 0 A peak	LIST/PULSE/ STEP functions 40 orders @ 50/60Hz	A peak	
requency Range Max. Current Measurement oltage ange cccuracy esolution furrent ange cccuracy (RMS) cccuracy (peak) esolution ower cccuracy esolution ower cccuracy esolution others ower Line Distortion imulation Vaveform Synthesis	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current	A peak	Delta: 120A 192/48/12 LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4  	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current	Y: L-N) ; Y: 160A *6 0 A peak  	LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current	4 A peak	
requency Range Max. Current Measurement leasurement leasurement leasurement leasurement ange ccuracy esolution ower ccuracy (Peak) esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution Aveform Synthesis larmonic Measurement	LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders	A peak	Delta: 120A 192/48/12 LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4  	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A *+0.4% F.S 0.1 A *+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz \$0/current 40 orders	Y: L-N) ; Y: 160A *6 0 A peak  	LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders	4 A peak   	
requency Range Max. Current Measurement oltage ange accuracy esolution Gurrent ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ange ang	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz	A peak	Delta: 120A 192/48/12 192/48/12 LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @50/60Hz	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4  	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A *+0.4% F.S 0.1 A *+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz	Y: L-N) ; Y: 160A *6 0 A peak  	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz	4 A peak	
requency Range lax. Current leasurement oltage ange ccuracy esolution urrent ange ccuracy (RMS) ccuracy (peak) esolution ower ccuracy esolution thers ower Line Distortion imulation /aveform Synthesis armonic Measurement rogrammable Impedance	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 192/48/12 LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz Voltage/Current 40 orders	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4    	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 W UIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz	Y: L-N) ; Y: 160A *6 0 A peak  	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
requency Range fax. Current feasurement oltage ange ccuracy esolution urrent ange ccuracy (RMS) ccuracy (peak) esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower ccuracy esolution ower fine Distortion imulation for synthesis	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 192/48/12 LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz Voltage/Current 40 orders	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4     0.1	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz	Y: L-N) ; Y: 160A *6 0 A peak  	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
requency Range Max. Current Measurement leasurement leasurement leasurement leasurement leasurement leasurement leasurement leasurement leasurement rogrammable Impedance fficiency *4 rotect	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4 0.4     0.1 UVP, OC	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A UIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω + 200µH ~ 1 Ω +1mH 75 (Typical)	Y: L-N) ; Y: 160A *6 0 A peak 0	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
requency Range Max. Current Measurement foltage lange Accuracy tesolution Current lange Accuracy (RMS) Accuracy (peak) tesolution fower Accuracy tesolution Power Accuracy tesolution Power Accuracy tesolution Power Accuracy tesolution Power Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy tesolution Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Acu	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 ? A peak 0.4 0.4 0.4 0.4     0.1 UVP, OC	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200µH ~ 1 Ω +1mH 75 (Typical) P, OPP, OTP, FAN	Y: L-N) ; Y: 160A *6 0 A peak 0	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
requency Range Aax. Current Aeasurement foltage lange Accuracy tesolution Current lange Accuracy (RMS) Accuracy (peak) Accuracy (peak) Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy Accuracy	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200µH ~ 1 Ω +1mH 75 (Typical) P, OPP, OTP, FAN	Y: L-N) ; Y: 160A *6 0 A peak 0	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
irequency Range Aax. Current Measurement Voltage Range Accuracy Resolution Current Resolution Cover Accuracy (RMS) Accuracy (peak) Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power Accuracy Resolution Power	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω+200µH ~ 1 Ω+1mH 75 (Typical) P, OPP, OTP, FAN JSB, Ethernet (stance	Y: L-N) ; Y: 160A *6 0 A peak 0	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
Trequency Range  Ax. Current  Aeasurement  Alaage  Accuracy  Accuracy  Accuracy (RMS)  Accuracy (peak)  Accuracy (peak)  Accuracy  Accuracy Accuracy  Accuracy  Accur	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 10 +1mH 75 (Typical) P, OPP, OTP, FAN JSB, Ethernet (stance) 0°C ~40°C 10°C~85°C	Y: L-N) ; Y: 160A *6 0 A peak 0	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
Frequency Range  Ax. Current  Measurement  /oltage  Ange  Accuracy  Resolution  Current  Accuracy (RMS)  Accuracy (peak)  Resolution  Power  Accuracy  Resolution  Dthers  Power Line Distortion  Simulation  Naveform Synthesis  Harmonic Measurement  Programmable Impedance  Efficiency *4  Protect Interface Femperature  Dperating  Storage Humidity	128/32/8 / 128/32/8 / LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz 0 Ω +200μH ~	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A %+0.4% F.S 0.1 W LIST/PULSE/ STEP functions 40 orders @ 50/60Hz 1Ω+1mH 75 (Typical) P, OPP, OTP, FAN JSB, Ethernet (stance) 0°C ~40°C 10°C~85°C 0%~90%	Y: L-N) ; Y: 160A *6 0 A peak 0	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak   	
Voltage Operating Range *3         Frequency Range         Max. Current         Measurement         Voltage         Range         Accuracy         Resolution         Current         Range         Accuracy         Resolution         Current         Range         Accuracy (RMS)         Accuracy (peak)         Resolution         Dower         Accuracy         Resolution         Dower         Accuracy         Resolution         Dower         Accuracy         Resolution         Dower         Accuracy         Resolution         Dothers         Power Line Distortion         Simulation         Naveform Synthesis         Harmonic Measurement         Programmable Impedance         Efficiency *4         Protect         nterface         Remperature         Operating         Storage         Humidity         Safety & EMC         Dimension (H × W × D)	$\frac{128/32/8}{2}$ LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders ©50/60Hz 0Ω+200µH ~ 1Ω+1mH	A peak	Delta: 120A 192/48/12 IST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0Ω +200μH ~ 1Ω +1mH	; Y: 90A *6 1! 0.1 2 A peak 0.4 0.4 0.4 0.4 0.4 0.4 0.4 0.4	47-63 Hz Delta: 200A 50V / 300V %+0.2%F.S. 0.1 V 320/80/2 %+0.3%F.S. %+0.6%F.S. 0.1 A %+0.4% F.S 0.1 A W+0.4% F.S 0.1 A LIST/PULSE/ STEP functions 40 orders @ 50/60Hz Voltage/Current 40 orders @ 50/60Hz Voltage/Current # 50/60Hz V 50/60Hz V 50/60Hz V 50/60Hz	Y: L-N) ; Y: 160A *6 0 A peak 0 a peak        -	LIST/PULSE/ STEP functions 40 orders © 50/60Hz Voltage/Current 40 orders © 50/60Hz 0 Ω +200μH ~	4 A peak	

Note\*1 : Maximum distortion is tested on output 125VAC (150V RANGE) and 250VAC (300V RANGE) with maximum current to linear load.

Note\*2 : Load regulation is tested with sine wave and remote sense. Note\*3 : Models with 277VLN/480VLL(5 Wires) AC input voltage are available upon request.


Note\*4 : Efficiency is tested on input voltage 230V. Note\*5 : Dimension (H X W X D) with wheelsets : 1246x546x700 mm / 49.05x21.5x27.56 inch

Note\*6 : Maximum current on input neutral line

All specifications are subject to change without notice.

# PANEL DESCRIPTION

#### FRONT PANEL OVERVIEW

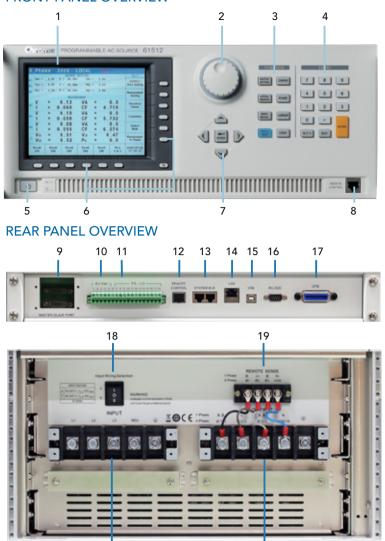

# ORDERING INFORMATION

20

61511: Programmable AC Source 0~300V, 15~1.5KHz/12KVA, 1ø/3ø 61512: Programmable AC Source 0~300V, 15~1.5KHz/18KVA, 1ø/3ø 61611: Programmable AC Source 0~300V, 15~1.5KHz/12KVA, 1ø/3ø 61612: Programmable AC Source 0~300V, 15~1.5KHz/18KVA, 1ø/3ø

\* Option for  $277V_{LN}/480V_{LL}(5 \text{ Wires})$  AC input voltage are available with 61511/61512/61611/61612/A615103 models. Please contact with local sales representative for ordering information.

1. LCD Display :

6.5 inches graphic LCD display for settings and measurements read back

- 2. Rotary Knob Use to adjust the voltage, frequency and parameters setting
- 3. Function key
  - Hot keys for quick parameter setting
- 4. Numeric key
- For data setting
- 5. Power Switch
- 6. Soft Keys

The soft-keys adjacent to the command block display on the LCD that provides users a menu driven interface to control the AC source operation

- 7. Cursor Key
  - For cursor movement
- 8. Remote Control Port
- 9. Master/Slave Port
- For Master-Slave parallel operation
- 10. External V reference External analog signal for voltage control
- 11 TTL I/O
  - Signals for system integration
- 12. Remote Control Port
- 13. System Bus
- 14. Ethernet Interface
- 15. USB Interface
- 16. RS-232 Interface
- 17. GPIB Interface
- 18. Input Power Selection Switch
  - $\triangle$  or Y 3-phase connection selection
- 19. Remote Sense Use to compensate the line drop between AC source and testing point
- 20. Input Terminal
- 21. Output Terminal

A615007: Softpanel for 61500/61600 Series

A615103: Parallable power stage unit 18KVA, 1ø/3ø

A615104: Input/Output terminals for parallel connecting (2 units) A615105: Input/Output terminals for parallel connecting (3 units) A615106: Reverse Current Protection Unit for 61511/61512/61611/61612

Get more product & global distributor information in Chroma ATE APP



HEADQUARTERS CHROMA ATE INC. 66 Huaya 1st Road, Guishan, Taoyuan 33383, Taiwan T +886-3-327-9999 F +886-3-327-8898 www.chromaate.com info@chromaate.com

U.S.A. CHROMA SYSTEMS SOLUTIONS, INC. 19772 Pauling, Foothill Ranch, CA 92610 T +1-949-600-6400 F +1-949-600-6401 www.chromausa.com

EUROPE CHROMA ATE EUROPE B.V. Morsestraat 32, 6716 AH Ede, The Netherlands T+31-318-648282 F+31-318-648288 www.chromaeu.com sales@chromaeu.com

sales@chromausa.com CHROMA GERMANY GMBH Südtiroler Str. 9, 86165, Augsburg, Germany T +49-821-790967-0 F+49-821-790967-600 www.chromaeu.com sales@chromaeu.com

21

JAPAN CHROMA JAPAN CORP. 888 Nippa-cho, Kouhoku-ku, Yokohama-shi, Kanagawa, 223-0057 Japan T +81-45-542-1118 F +81-45-542-1080 www.chroma.co.jp info@chroma.co.jp

KOREA CHROMA ATE KOREA BRANCH 3F Richtogether Center, 14, Pangyoyeok-ro 192, Bundang-gu, Seonanam-si Gyeonggi-do 13524, Korea T +82-31-781-1025 F +82-31-8017-6614 www.chromaate.com erica.shih@chromaate.co.kr

CHINA CHROMA ELECTRONICS QUANTEL PTE LTD. (SHENZHEN) CO., LTD. 8F, No.4, Nanyou Tian An Industrial Estate, Shenzhen, China T +86-755-2664-4598 F +86-755-2641-9620 www.chroma.com.cn info@chromaate.com

SOUTHEAST ASIA (A company of Chroma Group) 25 Kallang Avenue #05-02 Singapore 339416 T +65-6745-3200 F +65-6745-9764 www.quantel-global.com sales@quantel-global.com